# **User manual M3**

# Alternating voltage / Alternating current signals rms-value (TRMS) 0-50 VAC, 0-5 AAC



#### **Technical features:**

- red display from -19999...99999 digits (optional green, orange, blue or tricolour display)
- installation depth: 120 mm without plug-in screw terminal
- multi voltage power supply unit 100-240 VAC, alternatively 10-40 VDC galvanic isolated
- adjustment via factory setting or directly on the sensor signal
- min/max-memory with adjustable permanent display
- 30 additional adjustable support points
- display flashing at threshold value exceedance / undercut
- navigation keys for the triggering of Hold, Tara, display change, setpoint setting, alarm actuation
- flexible alarm system with adjustable delay times
- power measurement and energy measurement at constant voltage
- mathematical functions like reciprocal value, square root, square and rounding
- constant setting / setpoint setting
- sliding averaging
- brightness control via parameter or front keys
- programming interlock via access code
- protection class IP65 at the front
- plug-in screw terminal
- optional: 1 or 2 relay outputs
- optional: 1 independently scalable analog output
- optional: interface RS232 or RS485
- accessories: pc-based configuration-kit PM-TOOL with CD & USB adapter
- on demand: devices for working temperatures of -25°C...60°C

# Identification

STANDARD TYPES	ORDER NUMBER
Alternating current / Alternating voltage	M3-3VR5B.0004.S70xD
Housing size: 96x24 mm	M3-3VR5B.0004.W70xD

# Options - breakdown of order code:

	N	1	3-	3	V	R	5	В.	0	0	0	4.	W	7	2	X	D	
Standard type M-line	ı																	<b>Dimension</b> Diphysical unit
Installation depth mm																		Ш, ,
144 mm (154 mm),	3																	Version
incl. plug-in terminal																		x internal version
Housing size																		Switching points
B96xH24xD120 mm	1																	0 no switching point
																		1 1 relay output
Type of display V, A	V																	2 2 relay outputs
																		Protection class
Display colours	_																	1 without keypad,
	B G																	operation via PM-TOOL  7 IP65 / plug-in terminal
	R																	7 IP 05 / plug-in terminal
	<u>'\</u> Y						-											Voltage supply
L																		S 100-240 VAC
Number of digits																		W 10-40 VDC galv. isolated
	5																	
_	•																	Measuring input
Digit height 14 mm B													4 AC voltage/current, TRMS					
Analog output																		
Digital input 0 without																		
without 0																		
Interface RS232 3																		
Interface RS485	4																	Sensor supply
																		0 without

# Please state physical unit by order, e.g. A.

#### Contents 1. **Brief description** 2 2. **Assembly** 2 3. **Electrical connection** 3 4. Description of function and operation 4 4.1. Programming software PM-TOOL 5 5. 6 Setting up the device 5.1. Switching on 6 5.2. Standard parameterisation (flat operation level) 6 Value assignment for the triggering of the signal input 5.3. Programming interlock "RUN" 8 Activation/Deactivation of the programming interlock or change into professional or flat operation level 5.4. Extended parametersation (professional operation level) 9 5.4.1. Signal input parameters "IMP" 9 Value assignment for the triggering of the signal input incl. linearisation 5.4.2. General device parameters "FLT" 12 Superior device functions like Hold, Tara, min/max permanent, setpoint value function / nominal value function, averaging, brightness control, suppression of negative Offsets, as well as the control of the keyboard layout 5.4.3. Safety parameters "COD" 15 Assignment of user and master code to lock or to receive access to defined parameter such as analog output and alarms, etc 5.4.4. Serial parameters "SER" 16 Parameter for interface definition 5.4.5. Analog parameters "OUT" 17 Analog output functions 5.4.6. Relay functions "REL" 19 Parameter for setpoint definition 5.4.7. Alarm parameters "RL1...RL4" 20 Actuator and dependencies of the alarms 5.4.8. Totaliser (Volume metering) "TOT" 22 Parameter for calculation of the sum function 23 6. Reset to factory settings Reset parameters onto the delivery state 7. Alarms / Relays 24 Functional principle of the switching outputs 8. Interfaces 25 Connection of RS232 and RS485 9. Sensor aligment 26 Diagram of functional sequences for sensors with existing adjustable resistor 10. **Technical data** 27 11. Safety advices 29

30

12.

**Error elimination** 

### 1. Brief description

The panel meter instrument **M3-34** is a 5-digit device for AC current / AC voltage signals (TRMS) and a visual threshold value monitoring via the display. The configuration happens via three keys at the front or by the optional PC software PM-TOOL. The integrated programming interlock prevents unrequested changes of parameters and can be unlocked again with an individual code. Optional the following functions are available: one analog output and interfaces for further evaluating in the unit.


With help of the two galvanic isolated setpoints (optional), free adjustable limit values can be controlled and reported to a superior master display.

The electrical connection is done via plug-in terminals on the back side.

Selectable functions like e.g. the recall of the min/max-value, an averaging of the measuring signals, a nominal presetting or setpoint presetting, a direct threshold value regulation during operation mode and further measuring setpoints for linearisation, complete the modern device concept.

# 2. Assembly

Please read the Safety advices on page 29 before installation and keep this user manual for future reference.

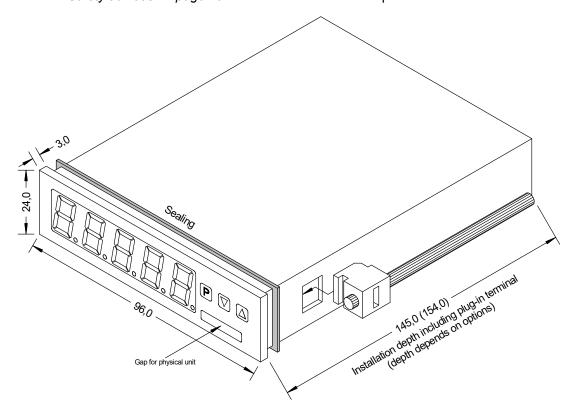


- 1. After removing the fixing elements, insert the device.
- 2. Check the seal to make sure it fits securely.
- 3. Click the fixing elements back into place and tighten the clamping screws by hand. Then use a screwdriver to tighten them another half a turn.

# CAUTION! The torque should not exceed 0.1 Nm!

The dimension symbols can be exchanged before installation via a channel on the side!

# 3. Electrical connection

**Type M3-3VR5B.0004.S70xD** supply 100-240 VAC 50/60Hz, DC ±10% **Type M3-3VR5B.0004.W70xD** supply 10-40 VDC galv. isolated, 18-30 VAC 50/60Hz

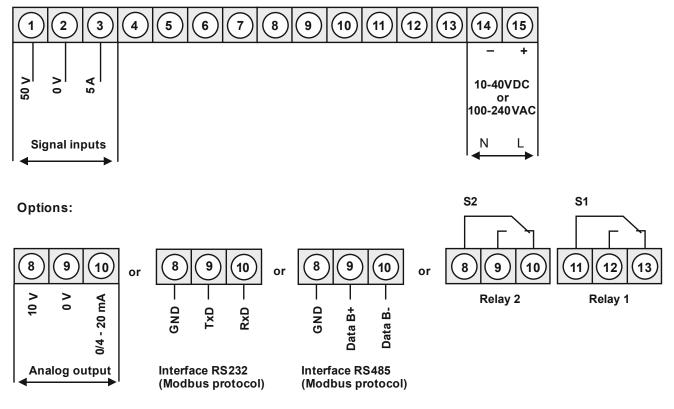

Alternative to analog output

## 4. Description of function and operation

#### Operation

The operation is divided into three different levels.

#### Menu level (delivery status)

This level was designed for the standard settings of the device. Only menu items which are sufficent to set the device into operation are displayed. To get into the professional level, run through the menu level and parameterise *PRDF* under menu item *RUN*.

#### Menu group level (complete function volume)


Suited for complex applications as e.g. linkage of alarms, setpoint treatment, totaliser function etc. In this level function groups which allow an extended parameterisation of the standard settings are availabe. To leave the menu group level, run through this level and parameterise ULDC under menu item RUM.

#### Parameterisation level:

Parameter deposited in the menu item can here be parameterised. Functions, that can be changed or adjusted, are always signalised by a flashing of the display. Settings that are made in the parameterisation level are confirmed with **[P]** and thus saved. Pressing the **[O]-key** leads to a break-off of the value input and to a change into the menu level. All adjustments are saved automatically by the device and changes into operating mode, if no further key operation is done within the next 10 seconds.

Level	Key	Description				
Р		Change to parameterisation level and deposited values.				
Menu-level		Keys for up and down navigation in the menu level.				
	0	Change into operation mode.				
	Р	To confirm the changes made at the parameterisation level.				
Parameterisation- level		Adjustment of the value / the setting.				
	0	Change into menu level or break-off in value input.				
	Р	Change to menu level.				
Menu-group-level		Keys for up and down navigation in the menu group level.				
	0	Change into operation mode or back into menu level.				

#### **Function chart:**

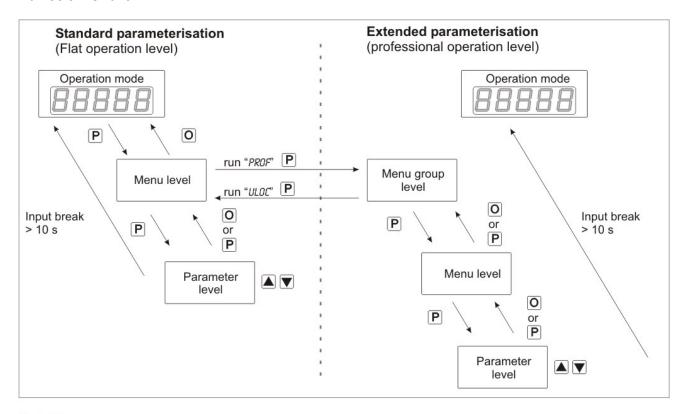

#### Underline:

P Takeover

O Stop

▲ Value selection (+)

▼ Value selection (-)

#### 4.1 Parameterisation software PM-TOOL:

Part of the PM-TOOL are the software on CD and an USB-cable with device adapter. The connection happens via a 4-pole micromatch-plug on the back side of the device, to the PC-side the connection happens via an USB plug.

System requirements: PC incl. USB interface Software: Windows XP, Windows VISTA

With this tool the device configuration can be generated, omitted and saved on the PC. The parameters can be changed via the easy to handle program surface, whereat the operating mode and the possible selection options can be preset by the program.

## 5. Setting up the device

#### 5.1. Switching on


Once the installation is complete, start the device by applying the voltage supply. Before, check once again that all electrical connections are correct.


#### Starting sequence


For 1 second during the switching-on process, the segment test (8 8 8 8 8) is displayed followed by an indication of the software type and, after that, also for 1 second the software version. After the starting sequence, the device switches to operation/display mode.

#### 5.2. Standard parameterisation: (Flat operation level)

To parameterise the display, press the **[P]-key** in operating mode for 1 second. The display then changes to the menu level with the first menu item *TYPE*.

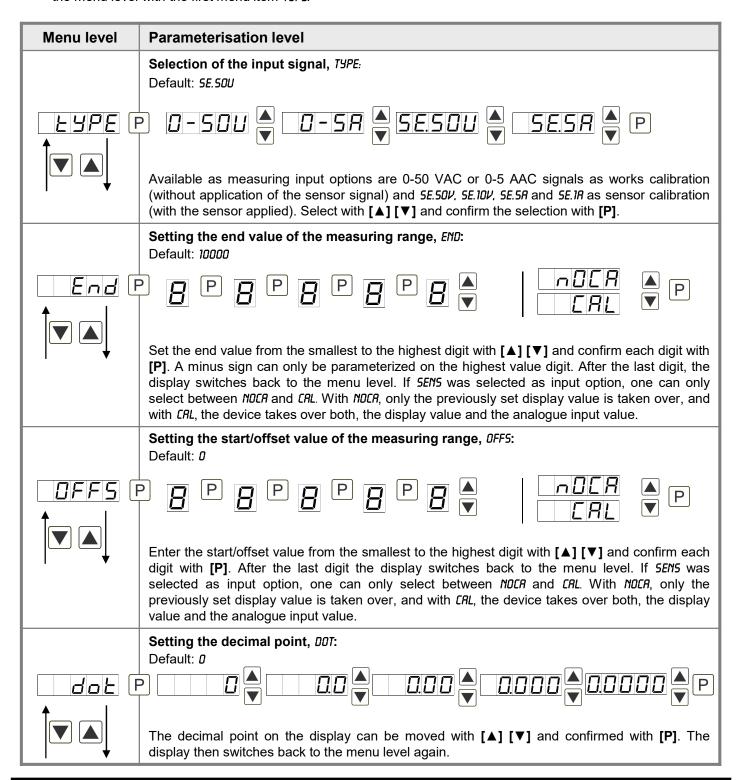


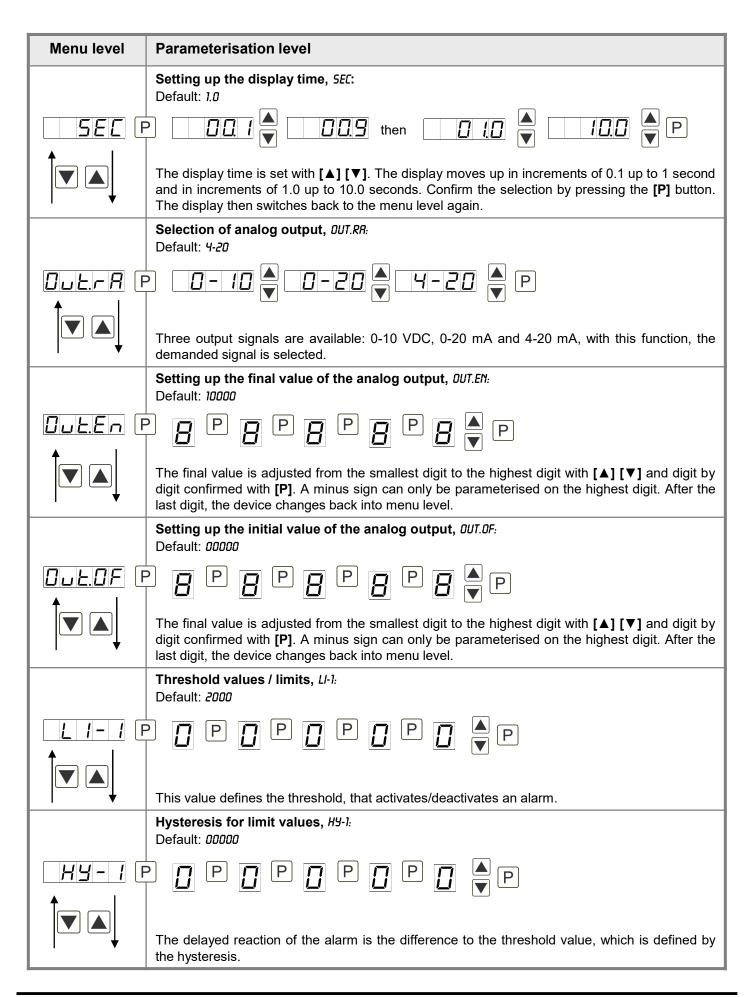


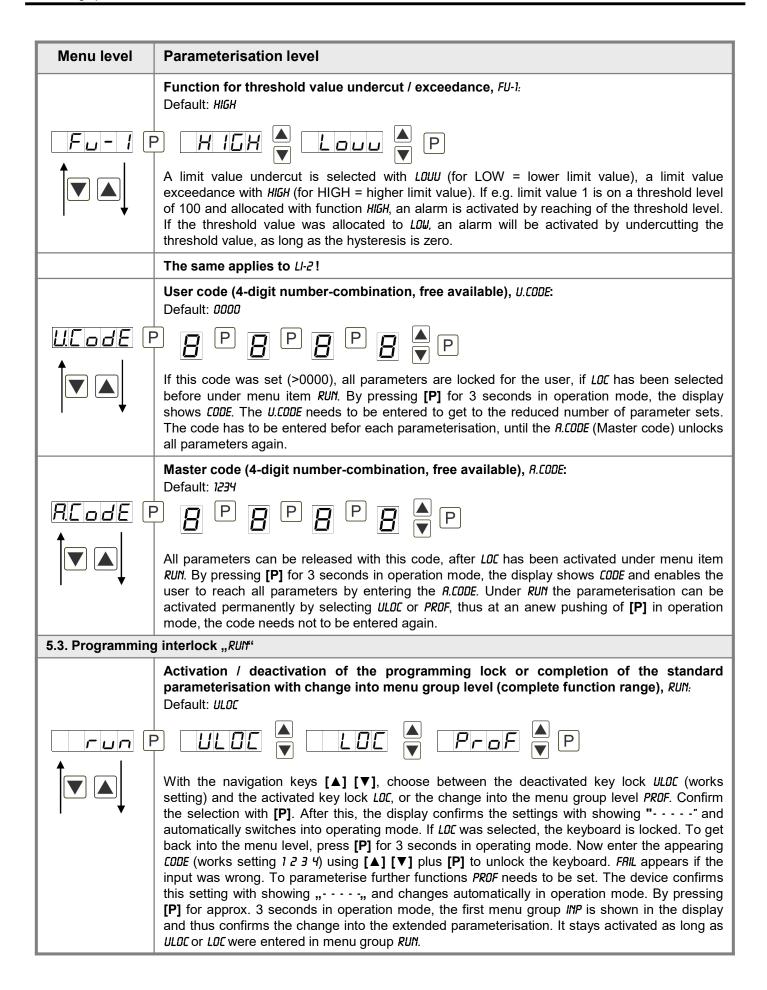



#### 5.4. Extended parameterisation (Professional operation level)

#### 5.4.1. Signal input parameters

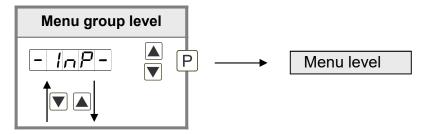


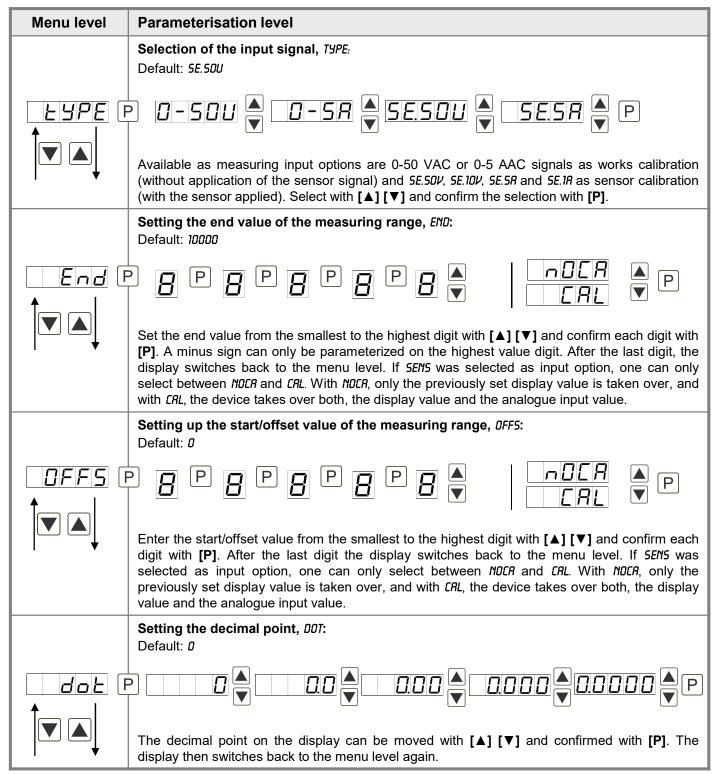


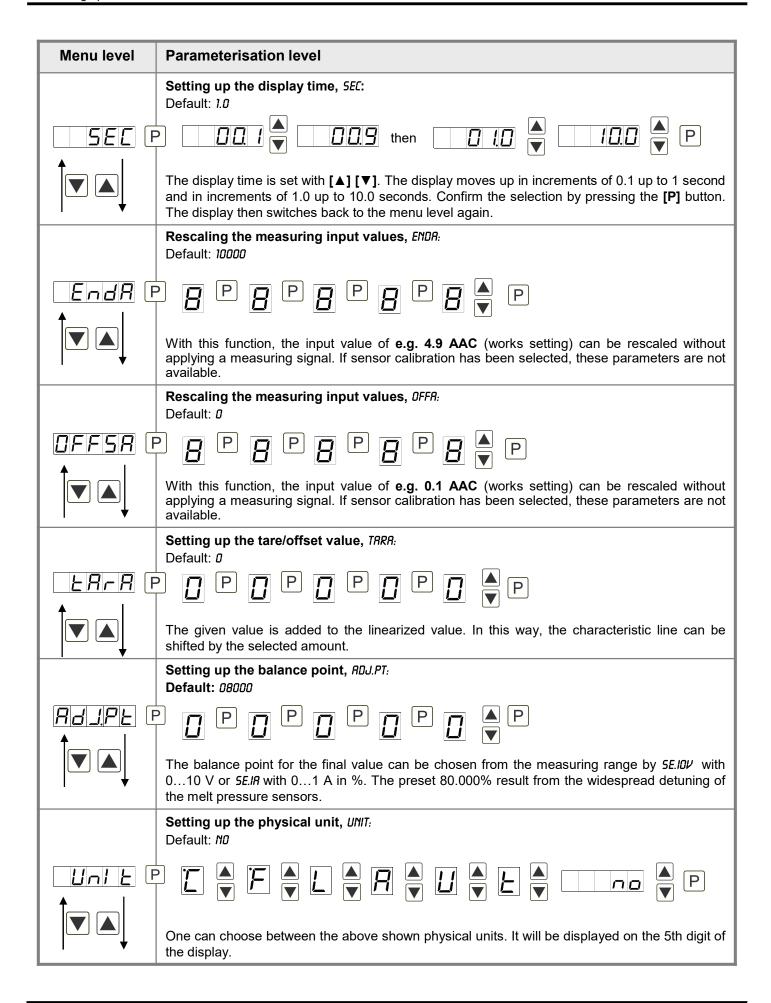


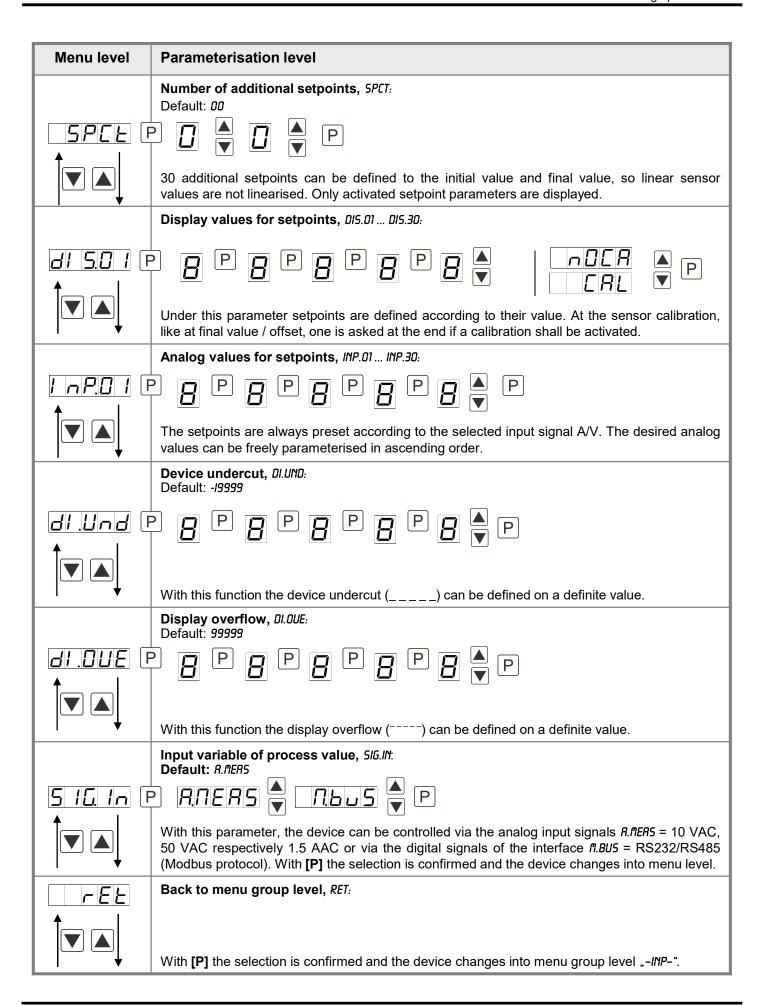


#### 5.4.2. General device parameters

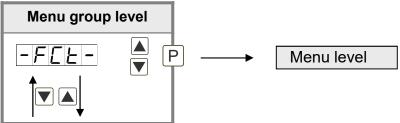


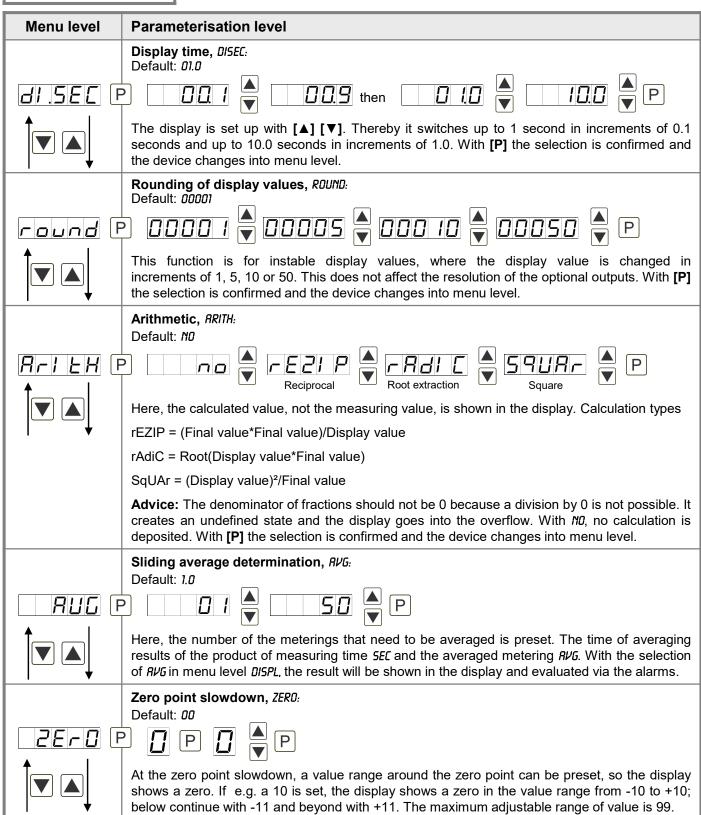


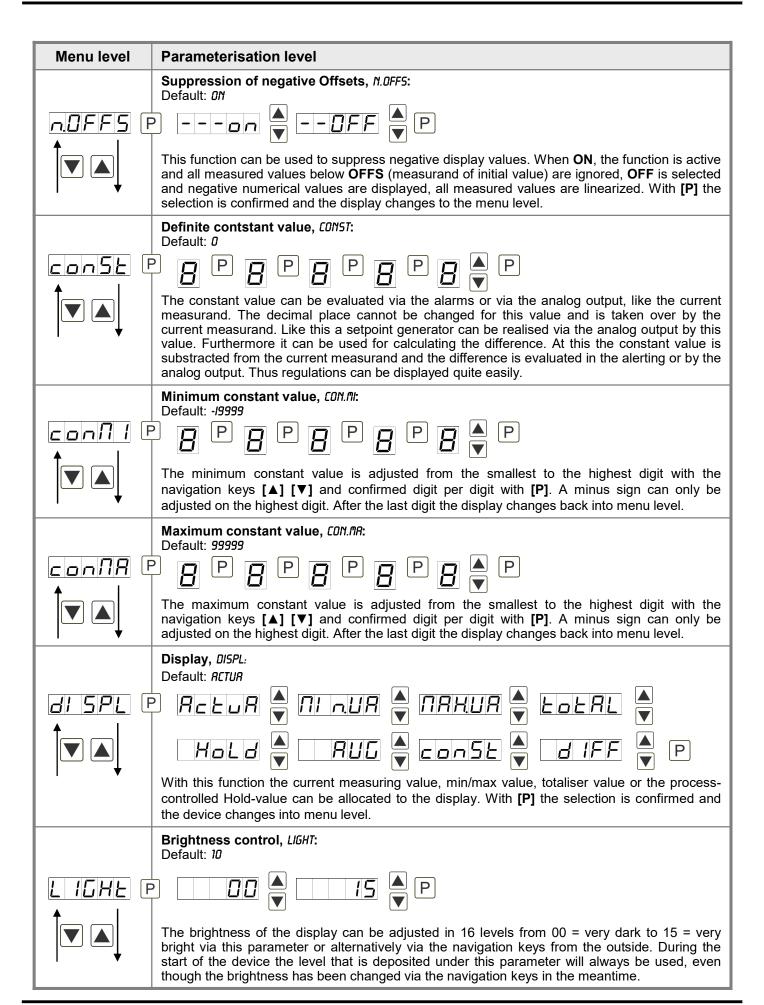

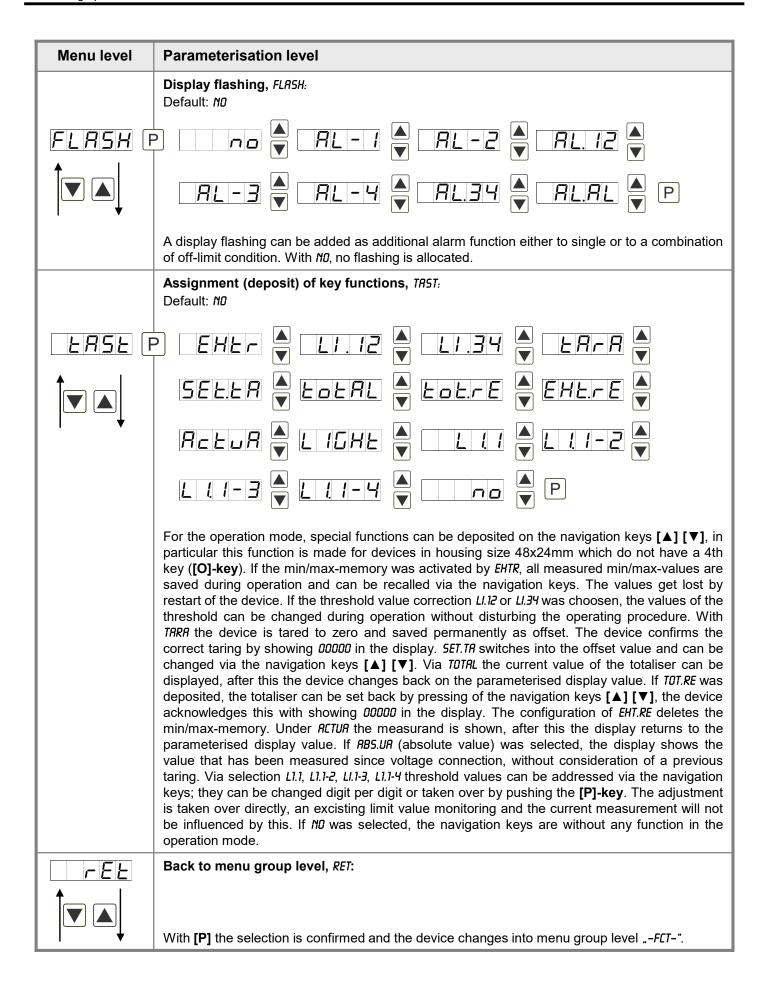



#### 5.4.3. Safety parameters

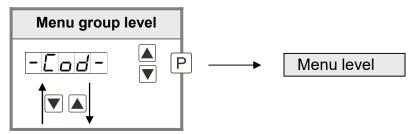

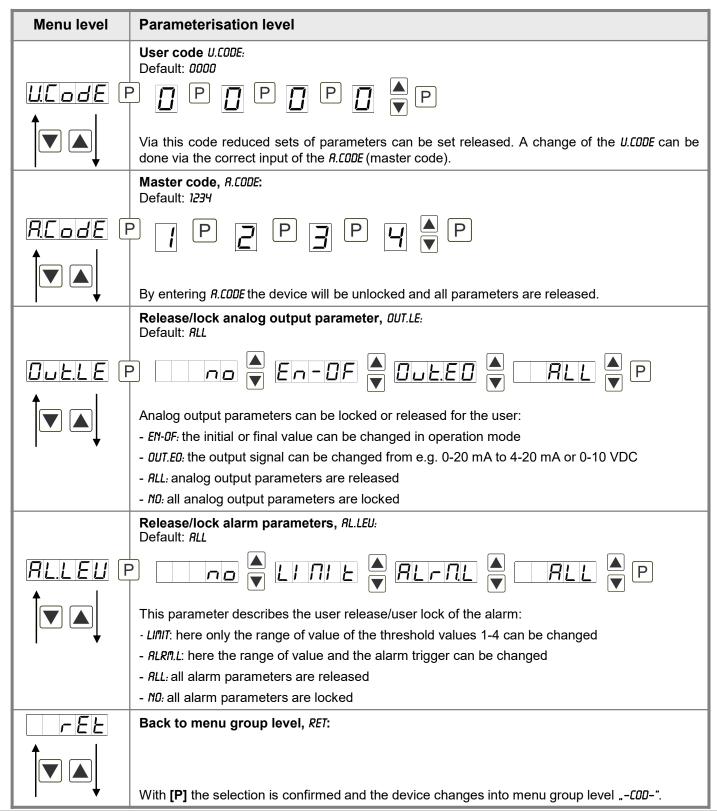



#### 5.4.4. Serial parameters

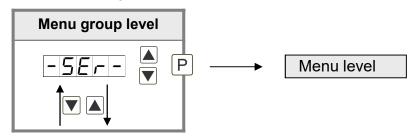


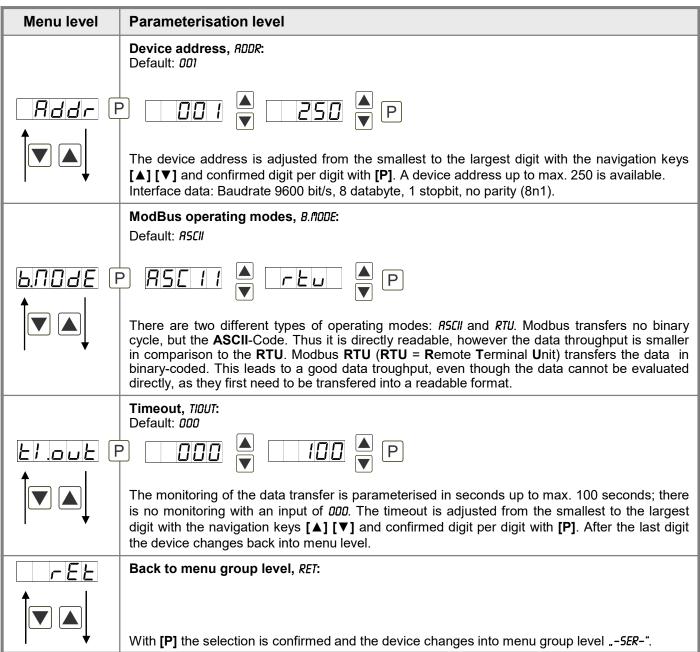


#### 5.4.5. Analog output parameters

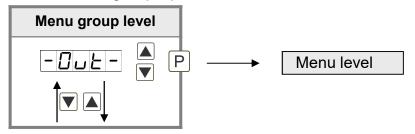


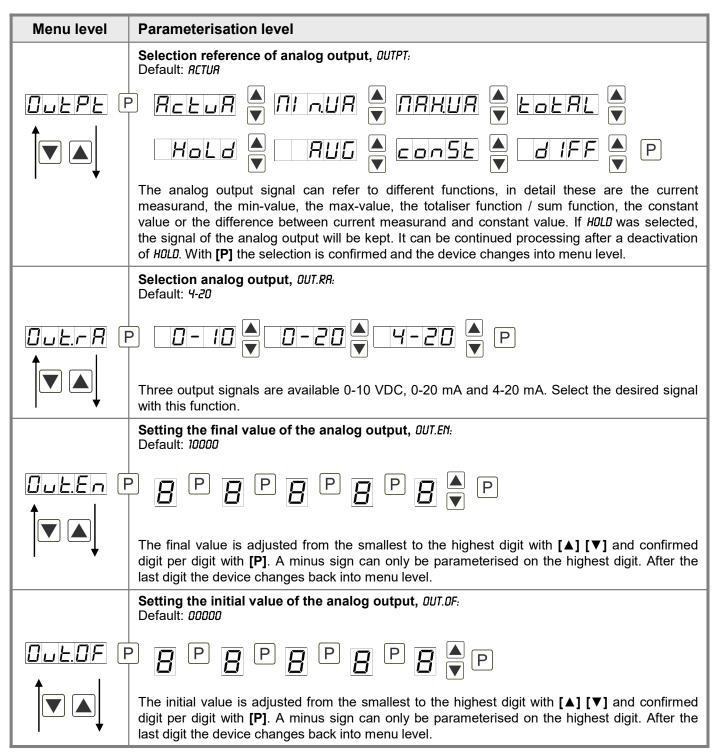


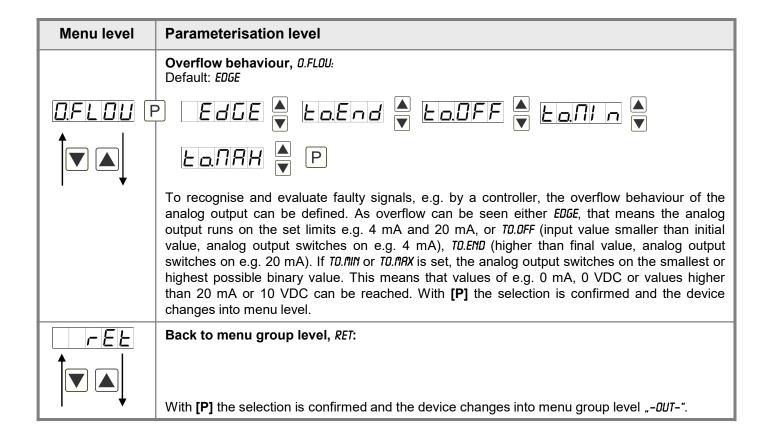


#### 5.4.6. Relay functions

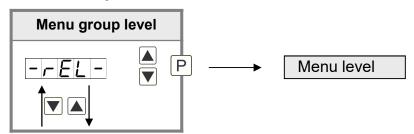


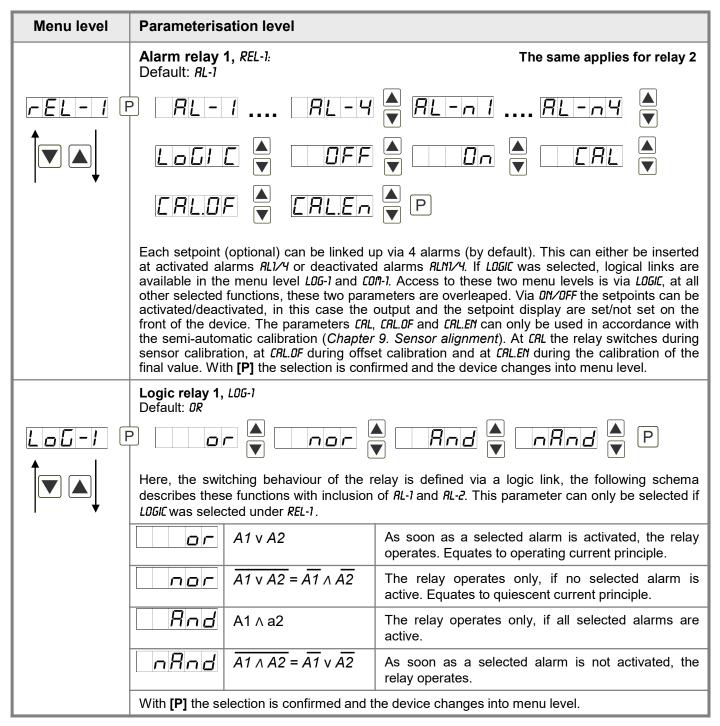


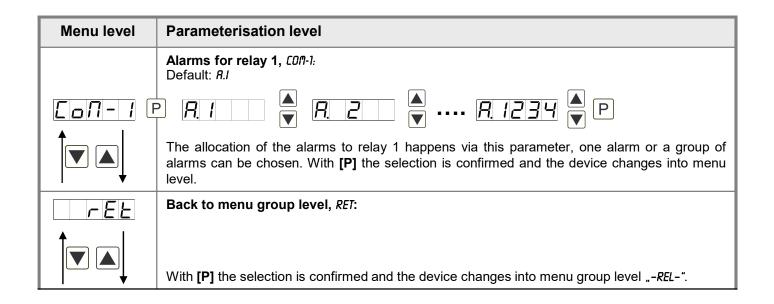

#### 5.4.7. Alarm parameters

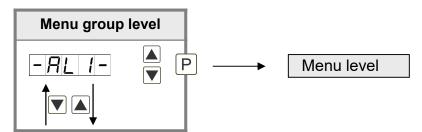


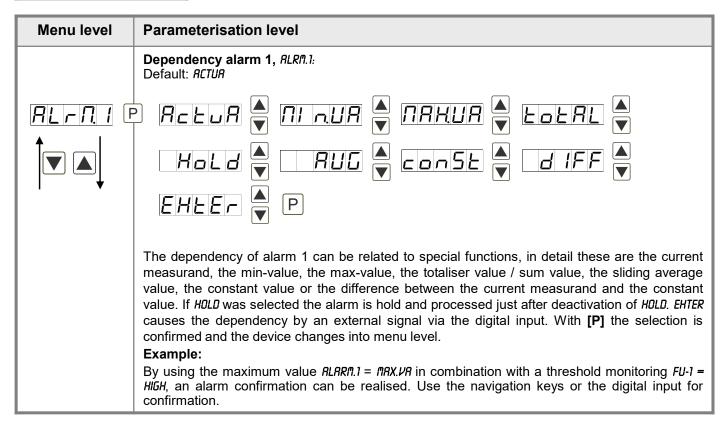


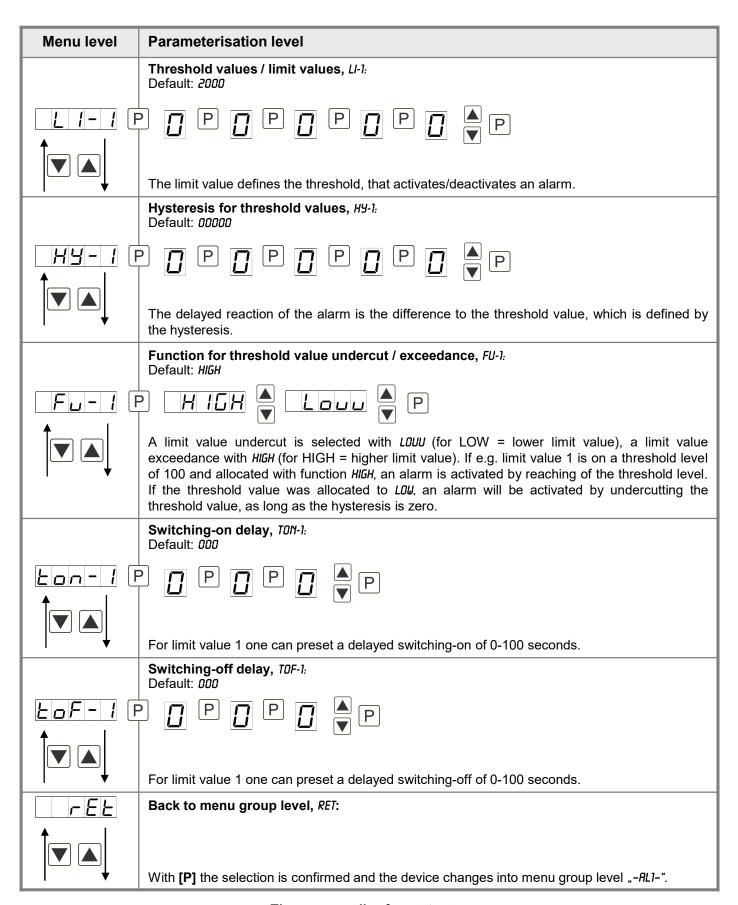


The same applies for RL2 to RL8.


#### 5.4.8. Totaliser (Volume metering)

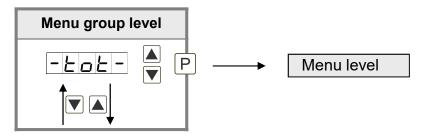

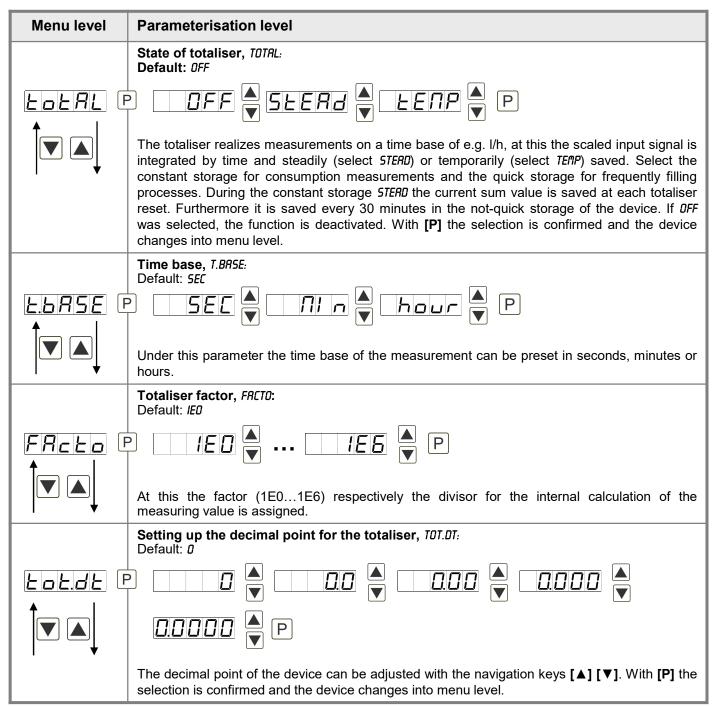

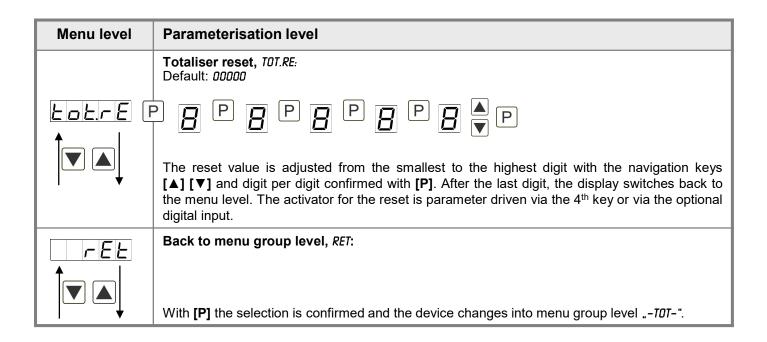

# Programming interlock, RUM:

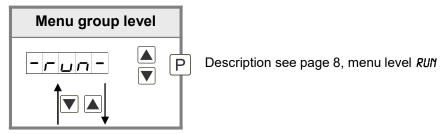

#### 6. Reset to default values

To return the unit to a **defined basic state**, a reset can be carried out to the default values.

The following procedure should be used:

- Switch off the power supply
- Press [P]-button
- Switch on voltage supply and press [P]-button until "----" is shown in the display.


With reset, the default values of the program table are loaded and used for subsequent operation. This sets the unit back to the state in which it was supplied.

#### Caution! All application-related data are lost.

## 7. Alarms / Relays


This device has 8 virtual alarms that can monitor one limit value in regard of an undercut or exceedance. Each alarm can be allocated to an optional relay output S1-S2; furthermore alarms can be controlled by events like e.g. hold value or min/max-value.

Function principle of alarms / relays					
Alarm / Relay x	deactivated, instantaneous value, min/max-value, hold-value, totaliser value, sliding average value, constant value, difference between instantaneous value and constant value or an activation via the digital input				
Switching threshold	Threshold / limit value of the change-over				
Hysteresis	Broadness of the window between the switching thresholds				
Working principle	Operating current / quiescent current				

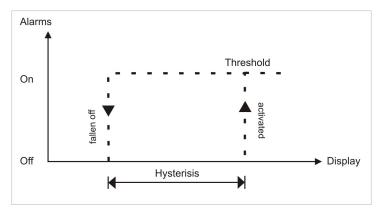


# **Operating current**

By operating current the alarm S1-S2 is **off** below the threshold and **on** on reaching the threshold.

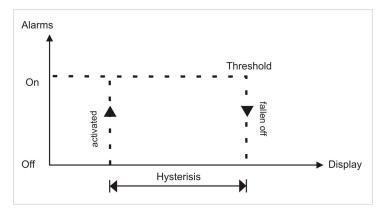

#### **Quiescent current**

By quiescent current the alarm S1-S2 is **on** below the threshold and switched **off** on reaching the threshold.

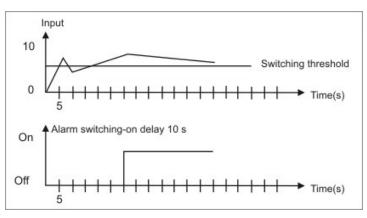

#### Switching-on delay

The switching-on delay is activated via an alarm and e.g. switched 10 seconds after reaching the switching threshold, a short-term exceedance of the switching value does not cause an alarm, respectively does not cause a switching operation of the relay. The switching-off delay operates in the same way, keeps the alarm / the relay switched longer for the parameterised time.

# 8. Interfaces

# **Connection RS232**


# Digital display M3

PC - 9-pole Sub-D-plug



# **Connection RS485**


# Digital display M3

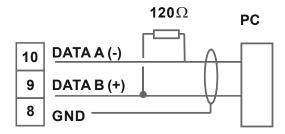

The interface **RS485** is connected via a screened data line with twisted wires (Twisted-Pair). On each end of the bus segment a termination of the bus lines needs to be connected. This is neccessary to ensure a secure data transfer to the bus. For this a resistance (120 Ohm) is interposed between the lines Data B (+) and Data A (-).

## 9. Sensor alignment offset / final value

The device is equipped with a semi-automatic sensor calibration (5E.10V, 5E.50V, 5E.5R, 5E.5R). A switching output operates the trimming resistor, which exists in some sensors. An adjustment of offset and final value takes place, after which the sensor can be used directly. Depending on parameterisation, the calibration can be realized via the 4th key or via the digital input. It is possible to key during the calibration steps. So, reference signals can be connected manually. However the calibration will be interrupted after 30 seconds.

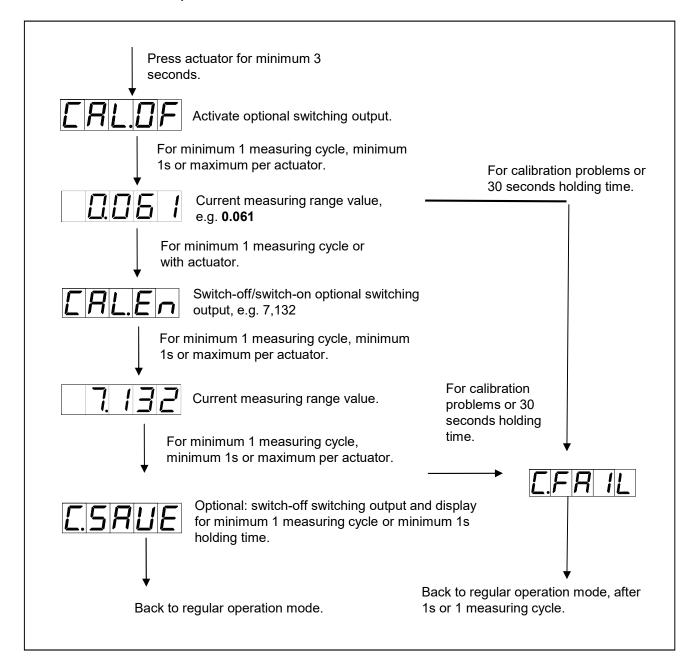

# 10. Technical data

Housing								
Dimensions	96x24x120 mm (BxHxD)							
	96x24x144 (154) mm (BxHxD) incl. plug-in terminal							
Panel cut-out	92.0 <sup>+0.8</sup> x 22.2 <sup>+0.3</sup> mm							
Wall thickness	up to 10 mm							
Fixing	screw elements							
Material	PC polycarbonate, black, UL94V-0							
Sealing material	EPDM, 65 Shore, black	•						
Protection class	standard IP65 (front), IP00	(back side)						
Weight	approx. 200 g							
Connection	plug-in terminal; wire cross	-section up to 2.5 mm <sup>2</sup>						
Display								
Digit height	14 mm							
Segment colour	red (optional green, orange	red (optional green, orange or blue)						
Range of display	-19999 to 99999							
Setpoint	one LED per setpoint							
Overflow	horizontal bars at the top							
Underflow	horizontal bars at the bottom							
Display time	0.1 to 10.0 seconds							
Input	Ri Measuring error Digit							
05 AAC TRMS	~ 0.05 Ω	0.5 % of final value	±1					
050 VAC TRMS	~ 200 kΩ 0.5 % of final value ±1							
Accuracy								
Drift of temperature	100 ppm / K							
Measuring time	0.110.0 seconds							
Measuring principle	U/F-conversion							
Resolution	approx. 18 bit at 1 second measuring time							
Output								
Analog output 0/4-20 mA / burden ≤500 Ohm, 0-10 VDC / burden ≥10 kOhm, 16 Bit								
Switching outputs								
Relay with change-over contact Switching cycles	250 VAC / 2 AAC; 30 VDC / 2 ADC 0.5 x 10 <sup>5</sup> at contact load 0.5 x 10 <sup>6</sup> mechanically Division according to DIN EN 50178 / Characteristics according to DIN EN 60255							

Interface	
Protocol	Modbus with ASCII or RTU-protocol
RS232	9.600 Baud, no parity, 8 Databit, 1 Stopbit, cable length max. 3 m
RS485	9.600 Baud, no parity, 8 Databit, 1 Stopbit, cable length max. 1000 m
Power supply	100-240 VAC 50/60 Hz / DC ±10% (max. 10 VA) 10-40 VDC galv. isolated, 18-30 VAC 50/60 Hz (max. 10 VA)
Memory	EEPROM
Data life	≥ 100 years / 25°C
Ambient conditions	
Working temperature	0°C50°C
Storing temperature	-20°C80°C
Weathering resistance	relative humidity 0-80% on years average without dew
EMV	EN 61326, EN 55011
CE-sign	conformity according to directive 2014/30/EU
Safety standard	according to low voltage directive 2014/35/EU EN 61010; EN 60664-1

## 11. Safety advices

Please read the following safety advice and the assembly *chapter 2* before installation and keep it for future reference.

#### Proper use

The **M3-34-device** is designed for the evaluation and display of sensor signals.



Danger!

Careless use or improper operation can result in personal injury and/or cause damage to the equipment.

#### Control of the device

The panel meters are checked before dispatch and sent out in perfect condition. Should there be any visible damage, we recommend close examination of the packaging. Please inform the supplier immediately of any damage.

#### Installation

The **M3-34-device** must be installed by a suitably **qualified specialist** (e.g. with a qualification in industrial electronics).

#### Notes on installation

- There must be no magnetic or electric fields in the vicinity of the device, e.g. due to transformers, mobile phones or electrostatic discharge.
- The fuse rating of the supply voltage should not exceed a value of 0.5A N.B. fuse!
- Do not install **inductive consumers** (relays, solenoid valves etc.) near the device and **suppress** any interference with the aid of RC spark extinguishing combinations or free-wheeling diodes.
- Keep input, output and supply lines separate from one another and do not lay them parallel with each other. Position "go" and "return lines" next to one another. Where possible use twisted pair. So, you receive best measuring results.
- Screen off and twist sensor lines. Do not lay current-carrying lines in the vicinity. Connect the **screening on one side** on a suitable potential equaliser (normally signal ground).
- The device is not suitable for installation in areas where there is a risk of explosion.
- Any electrical connection deviating from the connection diagram can endanger human life and/or can destroy the equipment.
- The terminal area of the devices is part of the service. Here electrostatic discharge needs to be avoided. Attention! High voltages can cause dangerous body currents.
- Galvanic isolated potentials within one complex need to be placed on a appropriate point (normally earth or machines ground). So, a lower disturbance sensibility against impacted energy can be reached and dangerous potentials, that can occur on long lines or due to faulty wiring, can be avoided.

# 12. Error elimination

	Error description	Measures
1.	The unit permanently indicates overflow.	<ul> <li>The input has a very high measurement, check the measuring circuit.</li> <li>With a selected input with a low voltage signal, it is only connected on one side or the input is open.</li> <li>Not all of the activated setpoints are parameterised. Check if the relevant parameters are adjusted correctly.</li> </ul>
2.	The unit permanently shows underflow.	<ul> <li>The input has a very low measurement, check the measuring circuit.</li> <li>With a selected input with a low voltage signal, it is only connected on one side or the input is open.</li> <li>Not all of the activated setpoints are parameterised. Check if the relevant parameters are adjusted correctly.</li> </ul>
3.	The word <b>HELP</b> lights up in the 7-segment display.	The unit has found an error in the configuration memory. Perform a reset on the default values and reconfigure the unit according to your application.
4.	Program numbers for parameterising of the input are not accessible.	Programming lock is activated     Enter correct code
5.	Err1 lights up in the 7-segment display.	Please contact the manufacturer if errors of this kind occur.
6.	The device does not react as expected.	If you are not sure that the device has been parameterised before, then follow the steps as written in chapter 6 and set it back to its delivery status.